

OFFICE OF THE MARION COUNTY SURVEYOR

SECTION RECORD CORNER

SECTION 17 TOWNSHIP 17 RANGE 4

DATE: 7-27-01

PARTY CHIEF: Wilcoxon

CREW: _____

TYPE OF MARKER: Harrison



METHOD OF ESTABLISHMENT: County: 8-9-98

IN. S.P.C. E ZONE NAD '83

NAME: 17041701

N: 519495.0761(m)

E: 62284.1394(m)

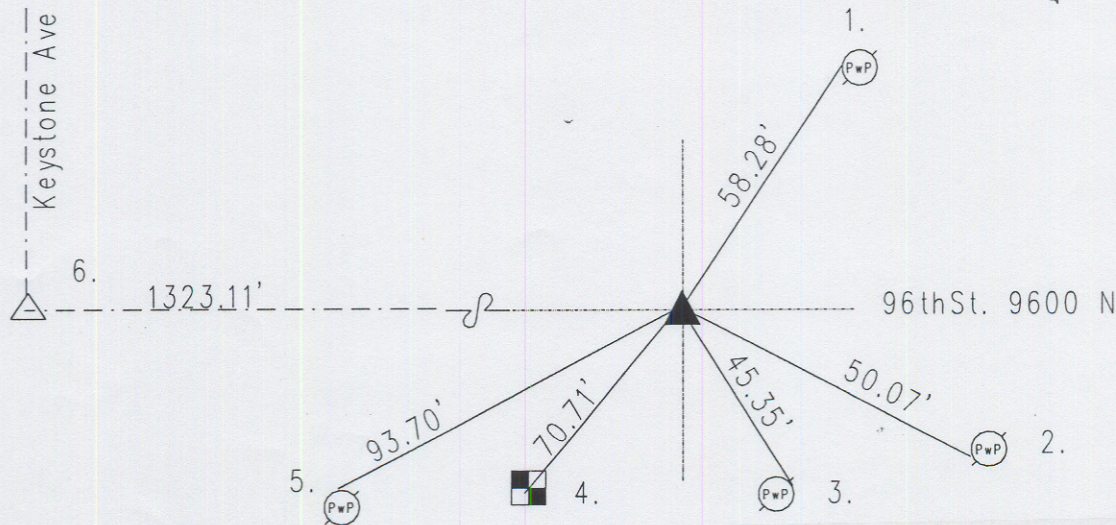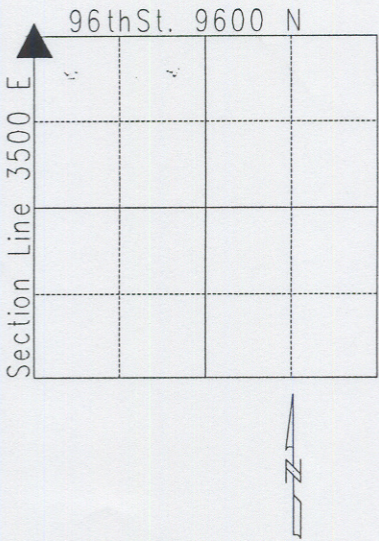

17041701 NW corner

CORNER HISTORY: A survey by Wm. B. Laughlin dated 1820 called witness: 20" locust N 21 W 25 links; 24" sugar N 68 E 41 links per Marion County Atlas pg. 12. A survey by Paul Julian dated 4-5-1894 called stone already set per Washington Township Legal Survey Book pg. 40. Reference dated 11-25-1949 by Gioscio called stone found 2" down per ties. Reference dated 7-13-1959 by Monroe called found a stone. Reference dated 2-2-1976 by Wilcoxon called railroad spike. Reference dated 6-2-1987 by Wilcoxon called for a disc in concrete. 1998 a Hamilton County road construction project destroyed the original monumentation for the section corner. The construction contractor was required by the Hamilton County Surveyor's Office to replace the marker with a Harrison Monument. In August 1998 the Marion County Surveyor's Office discovered the Harrison had been set incorrectly. This information was relayed to the Hamilton County Surveyor's Office. With a combined effort by Hamilton and Marion, the original corner location was found using Marion County GPS coordinates established before construction. Hamilton County than reset the Harrison in the original location. July 1998 Marion County again had reason to question the location. Marion County checked the location with GPS coordinates and found the monument was in the correct location. Reference dated 7-27-01 by Wilcoxon called set a Harrison.

REF.	DISTANCE	DESCRIPTION
1.	58.28'	PK nail W PwP#64-171 A 6"up
2.	50.07'	PK nail SW PwP#59-171 B 6"up
3.	45.35'	PK nail E PwP#53-171 B 6"up
4.	70.71'	Cut 'x' top of R/W marker
5.	93.70'	PK nail N PwP no# 12"up
6.	1323.11'	Due W to Keystone Avenue (Harrison Monument)